

6	Not working (Supply is defective)	1-An isolation transformer should be used while measuring the voltages on the primary side. 2-Driving signal must exist on the gate of Q802 (Scop). 3-There should be +12V DC supply voltage on the pin 1 of IC802. 4-Are all of the secondary voltages O.K? 5-Pin 41 of IC501 must be +5V in normal working mode and it must be 0V in ST-BY.	Q802,IC801,IC802,R806,R817, D801,D802,D803,D804,D807, D812,D823,Q810,TR802,F801, R813,R814,Q805,Q806,Q807, Q809
---	-----------------------------------	--	---