



Manual Control [F3] MDI [F5]

Axis: X Y Z


- + Continuous

Home Axis Touch Off

Override Limits

Spindle: Stop

X: 0.000
 Y: 0.000
 Z: 0.000
 Vel: 0.000
 DTG: 0.000

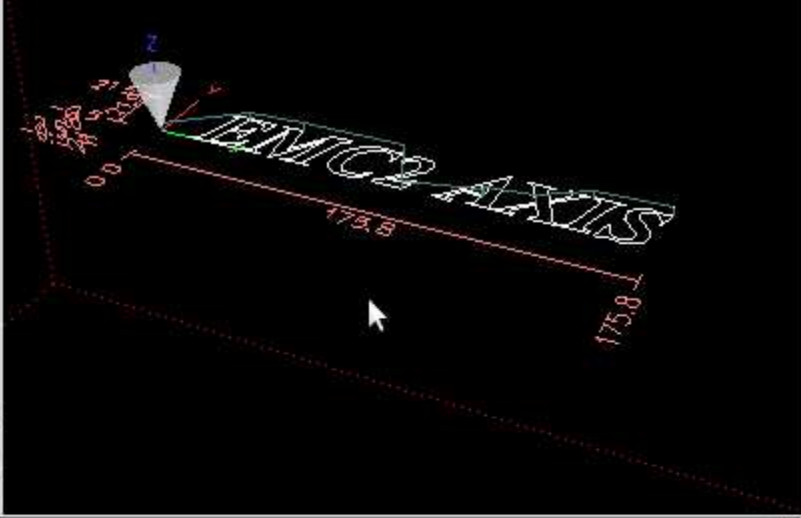

Feed Override: 100 %

Jog Speed: 25 mm/min

```
1: ( AXIS "splash g-code" )
2: ( Not intended for actual milling )
3: #1=.1 (SH)
4: #2=.01 (CUT)
5: #3=.0003 (SCALE)
6: #4=00 (FFFF)
```